



Fig. 41 Diagonal cracking and crushing of heavily reinforced masonry.



Fig. 42 Failure of a masonry chimney.



Fig. 43 Rehabilitation of an URM structure. Anchoring of slabs.

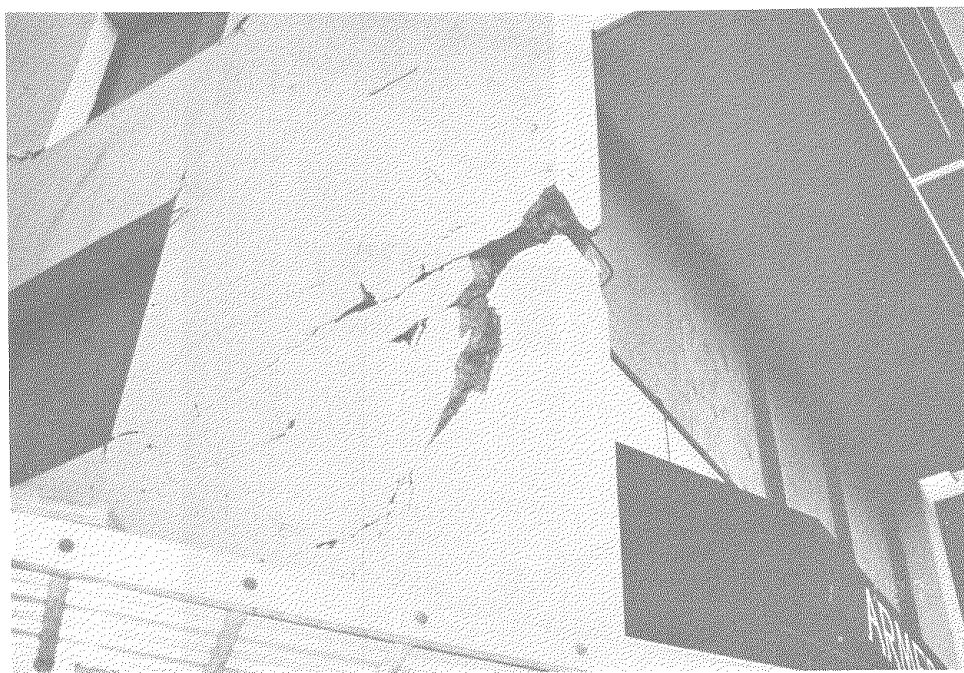


Fig. 44 Splice failure in RC boundary element.