

Fig. 9.7 Concrete sidewalk which buckled and fell upside down on Los Carneros Road north of Hollister Avenue, Adjacent pavement, curb, and gutter were not disturbed.

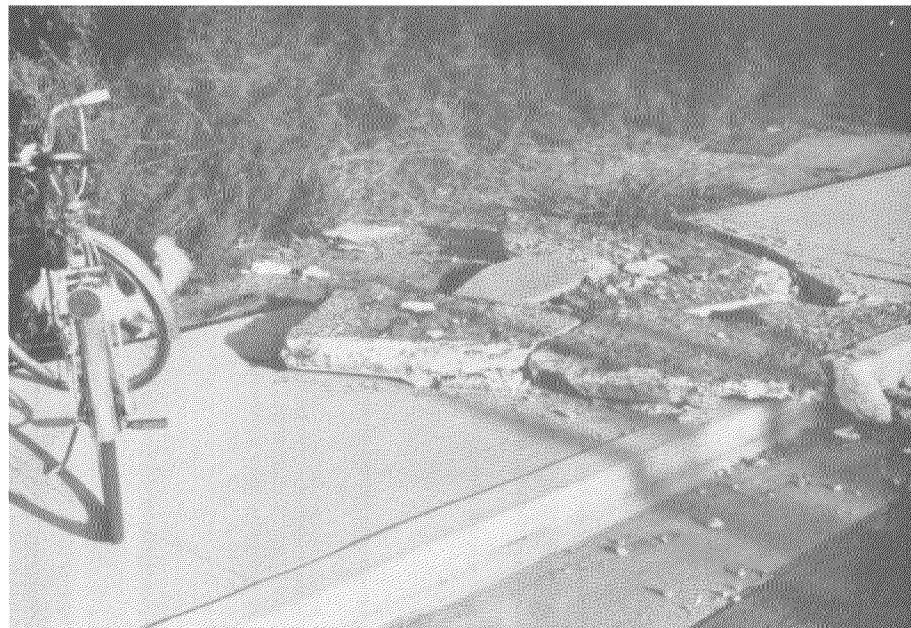


Fig. 9.8 View of sidewalk in Fig. 9.7 from opposite direction.