

Características del refuerzo: La estructura permanece en el mismo estado de daño que presentaba después del sismo de 1985. El edificio cambió de dueño y actualmente la planta baja se emplea como bodega (Foto 28). La parte más dañada del segundo nivel fue apuntalada con polines de madera con el fin de soportar las cargas verticales. Sin embargo, la estructura es inestable ante cargas laterales debido a que los elementos que resistirían dichas fuerzas fueron severamente dañados. En la colindancia hacia la calle Santos Degollado, donde se concentró el daño en la estructura, se encuentra una estructura de un nivel empleada actualmente como florería, existiendo un alto riesgo de colapso hacia dicho establecimiento colindante.

Repair and/or strengthening method: As of september 1993, the structure show the same level of damage described. The building ownership changed and now the ground floor is used as a warehouse (Photo 28). The worst damaged area in the second floor was shored with wooden 4x4's to support the vertical loads. However, the structure is unstable against lateral loads because the elements which resist forces are severely damaged. Next to the edge towards Santos Degollado Street, there is a one-story flower shop. There is a high risk of collapse onto the flower shop.



Foto 28.- Edificio "Médico General" que permanece dañado desde el sismo de 1985.

Photo 28.- "Médico General" building without repair since 1985.