

2.25 Swetes Clinic

This building suffered substantial damage.

Personnel:

- Nurse - Mrs Augustus

Damage:

- Much of the corrugated galvanised sheeting was removed by Luis. Temporary repairs had been effected before the field visit on Wednesday 20 September.
- Water damage to floor tiles
- The garage roof was completely removed.

Utilities:

- Telephone - working
- Electricity - off
- Water - returned yesterday (95-09-19)

Observations:

- The windows were broken before Luis, thus allowing a lot of water to enter the building.
- There were specific arrangements in the design for accommodating plywood hurricane shutters. There were shutters in place during Luis.

However they did not cover the windows completely.

2.26 All Saints Clinic

This building suffered minor damage.

Personnel:


- The building was not occupied at the time of the visit but access to the inside was possible.

Damage:


- This was limited, mainly, to water ingress.

Observations:

- The water tank showed evidence of leaking over a long period of time.
- The building was well provided with hurricane shutters.
- Unshuttered windows were of aluminium louvres which were not damaged.

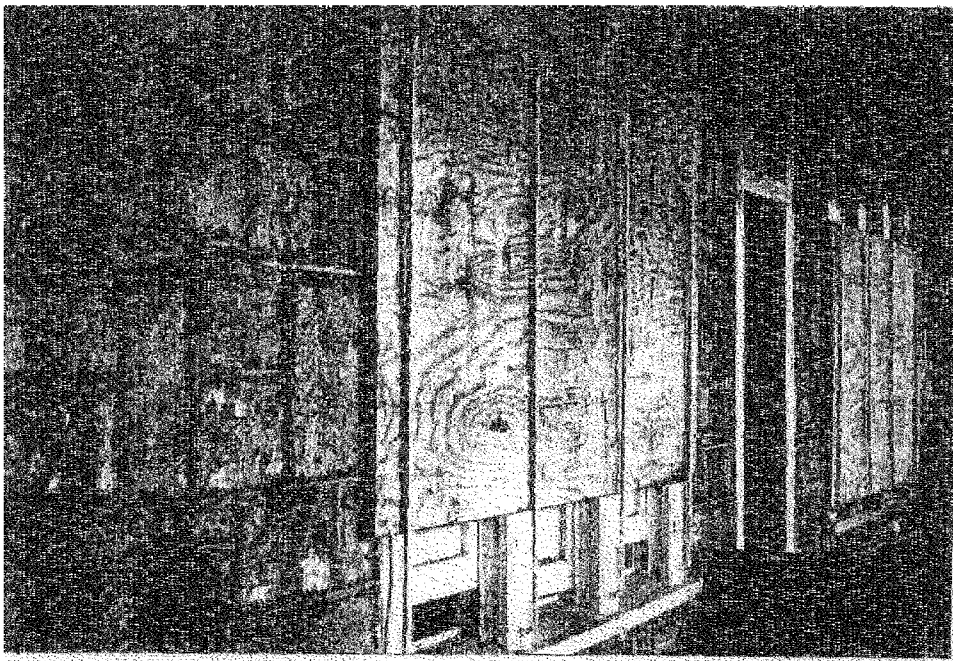

Swetes - partial covering of windows.

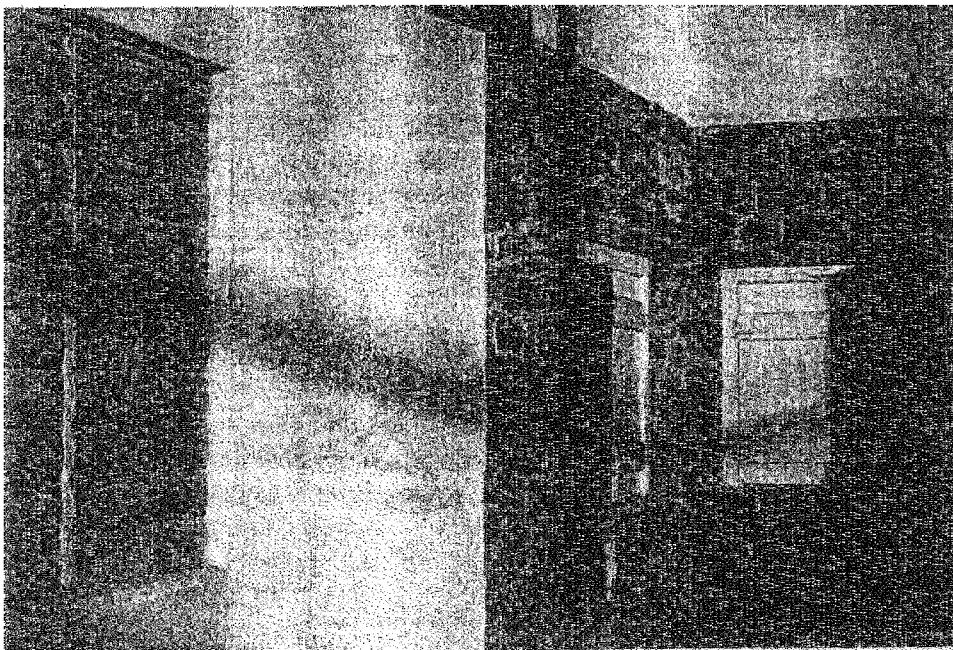

All Saints - well protected windows.